

3 1/2位數可程式盤面型數位電錶 (3 1/2 DIGITAL PANEL METER OF PROGRAMMABLE)

MODEL
M1

特點(FEATURES)



精確度0.1%滿刻度 ±1位數(Accuracy 0.1% F.S. ±1digit)
 可量測交直流電流/交直流電壓/電位計/傳送器/Pt-100/荷重元/電阻 等信號
 (Measuring DCA/DCV/ACA/ACV/Potentiometer/Transmitter/Pt-100/Load Cell/Resistor/etc.....)
 顯示範圍0-1999可任意規劃(Programmable rate 0 to 1999 digit)
 小數點可任意規劃(Decimal point can be modified)
 尺寸小,穩定性高(Dimension small and High stability)

(顯示範圍與規格)

[最小值]-[最大值]-[單位]
 [Min.] - [Max.] - [Unit]


1.MODEL:M1-
(選購型號)

NO	Input Type	NO	DCV(ACV)	NO	DCA(ACA)	NO	Potentiometer	NO	Transmitter	NO	Pt-100	NO	Load Cell	NO	Aux. Power
A	DC	11	0-50mV	21	0-19.99uA	31	0-10%	41	DC4-20mA	51	-50.0+50.0	61	2mV/V	A	AC110/220V
B	AC(RMS)	12	0-5V	22	0-199.9uA	32	0-50%	42	DC1-5V	52	-100.0+100.0	62	3mV/V	O	SPECIFIED
C	AC(TRMS)	13	0-10V	23	0-1.999mA	33	0-100%	43	DC4-20mA	53	-199.9+199.9	63	2mV/V	± 20% of rate less 3VA for AC input (50/60Hz)	
D	Potentiometer	14	0-36V	24	0-19.99mA	34	5-95%	44	DC1-5V	54	0+850	64	3mV/V		
E	Transmitter	15	0-54V	25	0-199.9mA	35	10-90%	49	SPECIFIED	55	-200+850	69	SPECIFIED		
F	Pt-100(RTD)	16	0-110V	26	0-1.999A	39	SPECIFIED	41/42 nonexciting DC20V 43/44 exciting DC20V(<25mA)	59	SPECIFIED	61/62 Exciting DC5V(<100mA) 63/64 Exciting DC10V(<50mA)				
H	Load Cell	17	0-600V	27	0-5.00A		Three wire connection Exciting voltage DC5V(<5mA)					Three wire connection non-programmable			
R	Resistor	18	0-1000V	28	0-10.00A										
O	SPECIFIED	19	SPECIFIED	29	SPECIFIED										


2.SPECIFICATION (主要規格)

Measuring accuracy : 0.1% F.S. ± 1 digit
 (精確度) (23 ± 5) 0.2% F.S. ± 1 digit(AC(RMS))
 Sampling time : 2 cycles/sec.
 (取樣時間)
 Zero (offset) range : 0- ± 100 digit adjustable
 (歸零調整範圍)
 Over input indication : " 1 " or " -1 "
 (過載顯示)
 Display : Red high efficiency LEDs high 14.22mm(.56")
 (顯示幕)
 Polarity display : When input is negative " _ " display
 (極性顯示)
 Temp. coefficient : 100ppm/ (0-50)
 (溫度係數)
 Dielectric strength : 2KVac/1 min. (input/power)
 (絕緣耐壓能力)
 Operating condition : 0-50 (20 to 90% RH non-condensed)
 (使用環境條件)
 Storage condition : 0-70 (20 to 90% RH non-condensed)
 (存放環境條件)

3.OUTSIDE DIMENSION AND CONNECTION DIAGRAM (外型尺寸與開孔尺寸與配線圖)

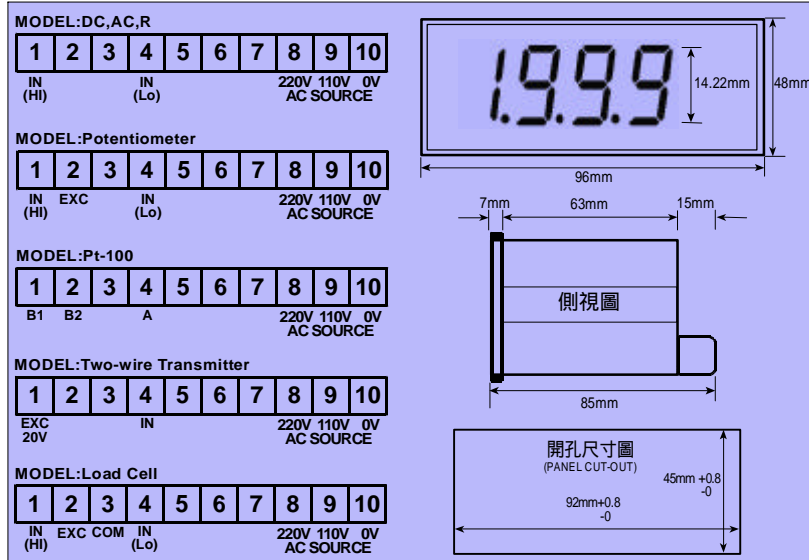

4.Program of span and zero and decimal point set (顯示值之小數點設定與歸零值與最大值校正位置圖)

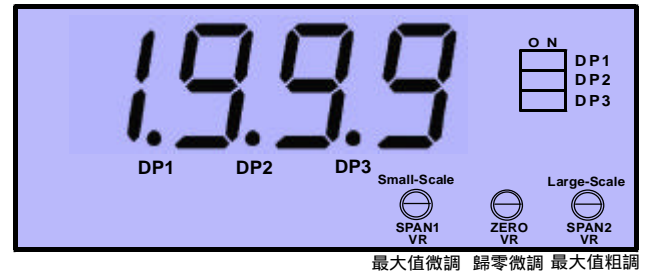

5.Application (應用實例)

Example:M1-A13A-0-100.0M/min

Input range : DC0-10V
 (輸入範圍)
 Readout range : 0-100.0M/min
 (顯示範圍)
 Aux. power supper: AC110V or 220V(50 or 60Hz)
 (輔助電源)

Adjusting process : (1)Set DP3 on(小數點 DP3 短路.)
 (調整步驟)
 (2)Set up input=10V, adjust SPAN2 nearly to 100.0 readout
 (輸入DC 10V於輸入端子,調整 SPAN2,使顯示值顯示於100.0附近.)
 (3)Set up input=0V, adjust ZERO to 00.0 readout
 (輸入DC 0V於輸入端子,調整 ZERO,使顯示值顯示於00.0.)
 (4)Set up input=10V, adjust SPAN1 to 100.0 readout
 (輸入DC 10V於輸入端子,調整 SPAN1,使顯示值顯示於100.0.)
 (5)END(完成調整步驟.)